

Lockwood Aviation Repair, Inc.

Invoice

1 Lockwood Lane
Sebring, FL 33870
863-655-6229

Date	Invoice #
8/31/2021	13177

Bill To
KT Auburndale, LLC 255 W. Van Fleet Drive Bartow, FL 33830 863-559-2211

PAID
09/03/2021

Ship To

P.O. Number	Terms	Rep	Ship	Via	F.O.B.	Project
N11851	Due on Receipt		8/31/2021		Sebring, FL	

Quantity	Item Code	Description	Price Each	Amount
1	Annual Aircam Am...	N11851 AirCam S/N AC-018 912ULS Left ESN: 4425163, Right ESN: 4425162 Hobbs: 404.5 Carburetor S/N's Left Engine: 1/3 - 990084, 2/4 - 990022 Right Engine: 1/3 - 990062, 2/4 - 990061 Gear Box S/N's (L) 15700 (R) 15699 C/W Annual/100 Hour Condition Inspection per Aircam w/Amphib Gear & Rotax M/M Checklists	2,677.50	2,677.50T
1	Oil Change	Left & Right Engines: Changed oil and filter: Cleaned oil tank installed new Rotax oil filter and serviced with Aeroshell Sport +4 oil - Leak checked OK. C/W SI-912-018 Purging of the Lubrication System and Hydraulic Valve Tappet Check - checked OK	0.00	0.00T
2	Disposal Fee	Waste Disposal Fee	3.00	6.00
1	Spark Plug Connect...	C/W 200 Hour Spark Plug Connector Pull-off check - checked OK. Gapped, applied heat transfer paste, and installed 8 new DCPR8E spark plugs.	0.00	0.00T
1	ELT INSP	C/W 1-Year ELT Inspection I/A/W FAR91.207d, Batteries Expire: February 2022.	0.00	0.00T
1	Service Bulletin	Checked all Rotax Engine and AirCam Aircraft service bulletins for compliance.	0.00	0.00T
1	Differential Compr...	Left Engine: C/W Rotax 100 Hour Diff. Compression Test, Results: Cyl 1: 80/80psi, Cyl 2: 80/80psi, Cyl 3: 80/80 psi. Cyl 4: 80/80psi.	0.00	0.00T
1	Differential Compr...	Right Engine: C/W Rotax 100 Hour Diff. Compression Test, Results: Cyl 1: 80/80psi, Cyl 2: 80/80psi, Cyl 3: 80/80 psi. Cyl 4: 79/80psi.	0.00	0.00T
1	CARBFLOAT	Left & Right Engines: C/W Rotax Annual Carburetor Float Bowl Inspection - checked OK.	0.00	0.00T
1	Annual Prop Inspec...	C/W Annual / 100 Hour Propeller Inspection I/A/W Warp Drive inspection and maintenance procedures.	0.00	0.00T
1	Carburetor Sync	Left & Right Engines: Performed Pneumatic Carburetor Sync and Idle adjustment.	0.00	0.00T

Total

Lockwood Aviation Repair, Inc.

Invoice

1 Lockwood Lane
 Sebring, FL 33870
 863-655-6229

Date	Invoice #
8/31/2021	13177

Bill To
KT Auburndale, LLC 255 W. Van Fleet Drive Bartow, FL 33830 863-559-2211

PAID
 09/03/2021

Ship To

P.O. Number	Terms	Rep	Ship	Via	F.O.B.	Project
N11851	Due on Receipt		8/31/2021		Sebring, FL	

Quantity	Item Code	Description	Price Each	Amount
1	Customer Discrepa...	CUSTOMER DISCREPANCY: Replace front and rear seat belts. ACTION: Removed front and rear seat belts and replaced with new I/A/W AirCam manual. Replaced rear seat pins with new.	119.00	119.00T
0.37	Shop Discrepancy	DISCREPANCY: Three main fly cables from wing struts and center are corroded. ACTION: Inspected and cleaned fly cables.	119.00	44.03T
0.17	Shop Discrepancy	DISCREPANCY: Screw head into RH center section cover stripped. ACTION: Drilled out stripped screw from RH center section and replaced with new.	119.00	20.23T
0.27	Shop Discrepancy	DISCREPANCY: Three mounting screws from instrument panel to nose cone are over tightened and heads are stripped. ACTION: Drilled out stripped over tightened screws from instrument panel to nose cone and replaced with new.	119.00	32.13T
0.28	Shop Discrepancy	DISCREPANCY: Right side rudder cable phenolic strip loosened from surface. ACTION: Removed and reattached RT rudder cable phenolic strip into place.	119.00	33.32T
0.4	Shop Discrepancy	DISCREPANCY: Flap motor checked bad. ACTION: Removed and replaced flap motor with new. C/W SB-14-004-A Flap Safety Cable Installation. Installed Flap Safety Cable P/N AC-FL-009.	119.00	47.60T
0.45	SI-AC-16-003	C/W AirCam SI-AC-16-003 - Installed grommets into LT/RT wing gap seal and zip tied gap seal to engine mount cross member and center section rear spar.	119.00	53.55T
5.33	ASB-AC-19-001	C/W AirCam ASB-AC-19-001 cable assembly nicopress inspection.Checked OK. All work completed I/A/W ASB-AC-19-001 narrativeand AirCam Construction and Assembly Manuals.	119.00	634.27T

Total

Lockwood Aviation Repair, Inc.

Invoice

1 Lockwood Lane
 Sebring, FL 33870
 863-655-6229

Date	Invoice #
8/31/2021	13177

Bill To
KT Auburndale, LLC 255 W. Van Fleet Drive Bartow, FL 33830 863-559-2211

PAID
 09/03/2021

Ship To

P.O. Number	Terms	Rep	Ship	Via	F.O.B.	Project
N11851	Due on Receipt		8/31/2021		Sebring, FL	

Quantity	Item Code	Description	Price Each	Amount
3.17	SB-AC-19-002	C/W AirCam SB-AC-19-002 - Inspected all external cable assemblies for corrosion I/A/W bulletin procedures. Removed LH and RH elevators and removed AC-HS-023 and AC-HS-024 horizontal stabilizer brace cable assemblies and replaced with new parts. Re-installed LH and RH elevators and re-connected elevator trim. All work completed I/A/W SB-AC-19-002 and AirCam Rigging Manual.	119.00	377.23T
0.63	ASB-AC-20-001	C/W AirCam ASB-AC-20-001 safety ring inspection. Inspected CS-152 safety rings for proper installation throughout control system. Safety wired safety ring to cable tang clear of interference at AC-CS-013 elevator turnbuckle. All work completed I/A/W ASB-AC-20-001 narrative and AirCam Construction and Assembly Manuals.	119.00	74.97T
1	NOTAM	2-Year Transponder check Due	0.00	0.00T
0.17	SB-912-029UL	Left & Right Engines: C/W SB-912-029UL Crankcase Inspection - checked OK.	119.00	20.23T
1	SB-912-039	Left & Right Engines: P/C/W SB-912-039 Overflow bottle vent.	0.00	0.00T
1	Service Bulletin	Left & Right Engines: SB-912-037UL Installation of Electric Starter with Enhanced Power - N/A	0.00	0.00T
1	Service Bulletin	Left & Right Engines: P/C/W SB-912-022UL Replacement of Valve Spring Retainer on Single Valve Spring Configuration.	0.00	0.00T
1	SB-912-073 / SB-9...	Left & Right Engines: C/W SB912-073 / SB-914-055 Replacement of circlip (Carburetor) for Rotax Engine type 912 and 914 (series). N/A per carburetor S/N's.	0.00	0.00T
0.1	Shop Discrepancy	DISCREPANCY: Play in Fore and AFT control sticks. ACTION: Applied loctite to Fore and AFT control sticks to remove play - OP's checked OK.	119.00	11.90T
2.8	SB-AC-10-104	C/W AirCam SB-AC-10-104 - Removed and replaced trim tab servo motor I/A/W servo installation guide and I/A/W AirCam manual.	119.00	333.20T
0.48	Shop Discrepancy	Left & Right Engines: DISCREPANCY: All exhaust springs are heavily corroded. ACTION: Removed 16 exhaust springs and replaced with new, safety wired and applied RTV silicone.	119.00	57.12T

Total

Lockwood Aviation Repair, Inc.

Invoice

1 Lockwood Lane
 Sebring, FL 33870
 863-655-6229

Date	Invoice #
8/31/2021	13177

Bill To
KT Auburndale, LLC 255 W. Van Fleet Drive Bartow, FL 33830 863-559-2211

PAID
09/03/2021

Ship To

P.O. Number	Terms	Rep	Ship	Via	F.O.B.	Project
N11851	Due on Receipt		8/31/2021		Sebring, FL	

Quantity	Item Code	Description	Price Each	Amount
1	NOTAM	Data Plate is difficult to read / finish is flaking off.	0.00	0.00T
0.45	Shop Discrepancy	DISCREPANCY: RT Aileron droop is incorrect. ACTION: Adjusted RT Aileron rod end to achieve 7/8" droop I/A/W AirCam Rigging Manual.	119.00	53.55T
1.95	Shop Discrepancy	DISCREPANCY: MLG tires checked bad. ACTION: Removed LT / RT MLG wheels, removed worn tires and replaced with new. Reinstalled LT / RT MLG wheels - OP's & Leak checked OK.	119.00	232.05T
40	5-YR RUBBER	Left & Right Engines: C/W 5-Year Rotax Rubber Component replacement: Removed and replaced all oil, coolant and fuel hoses. Replaced intake o-ring and coolant elbow o-rings. Installed fire sleeve over all oil and fuel lines. Installed new fuel pump P/N 893115, S/N's (R) 203241, (L) 211649. Installed new radiator cap with gasket. Drained coolant system and serviced with DexCool 50/50 - Leak checked OK. Installed new carburetor sockets. All systems OP's & Leak Checked OK. C/W Rotax Annual Carburetor Float Bowl Inspection. C/W Rotax 100 Hour checking of the ventilation of the float chambers. C/W Rotax 100 Hour Removal/Assembly of the two carburetors for carburetor inspection. C/W 200 Hour Carburetor Service Requirement per SI-912-021 Inspection of Carburetors and 5-Yr Rubber Replacement Requirements - installed new diaphragms & float needle valves. C/W SI-912-018 Purging of the Lubrication System and Hydraulic Valve Tappet Check - checked OK. Performed Pneumatic Carburetor Sync and Idle adjustment.	119.00	4,760.00T
0.6	Shop Discrepancy	Left & Right Engines: DISCREPANCY: Exhaust nuts heavily corroded. ACTION: Removed 16 exhaust nuts and replaced with new.	119.00	71.40T
1.22	Shop Discrepancy	DISCREPANCY: LT/RT Nose wheel tires and tubes checked bad. ACTION: Removed LT/RT nose wheel assemblies, removed tires and tubes, cleaned and installed new tires & tubes. Reinstalled Nose wheel assemblies - OP's & Leak checked OK.	119.00	145.18T

Total

Lockwood Aviation Repair, Inc.

Invoice

1 Lockwood Lane
 Sebring, FL 33870
 863-655-6229

Date	Invoice #
8/31/2021	13177

Bill To
KT Auburndale, LLC 255 W. Van Fleet Drive Bartow, FL 33830 863-559-2211

PAID
 09/03/2021

Ship To

P.O. Number	Terms	Rep	Ship	Via	F.O.B.	Project
N11851	Due on Receipt		8/31/2021		Sebring, FL	

Quantity	Item Code	Description	Price Each	Amount
0.35	Shop Discrepancy	DISCREPANCY: Left Main wheel bearings checked bad. ACTION: Removed and installed new bearings and races into left main wheel.	119.00	41.65T
0.25	Shop Discrepancy	DISCREPANCY: Found bad rivets in center of fuselage floor. ACTION: Removed bad rivets from center of fuselage floor and replaced with new.	119.00	29.75T
0.67	Shop Discrepancy	DISCREPANCY: Pilot and passenger slip skid @ seats requires replacement. ACTION: Removed deteriorated slip skid from pilot and passenger seat areas, cleaned surface and applied new slip skid.	119.00	79.73T
0.17	Shop Discrepancy	DISCREPANCY: LT/RT throttle cable splitters missing safety wire. ACTION: Safety wired throttle cable splitters I/A/W AirCam manual.	119.00	20.23T
1	Shop Discrepancy	DISCREPANCY: Nose Cone has 3" crack @ left front. ACTION: Removed for outside vendor repair. Reinstalled repaired nose cone.	0.00	0.00T
1	Misc Service	Outside Vendor Repair, Nose Cone	350.00	350.00T
1	Shop Discrepancy	DISCREPANCY: RT Engine oil pressure low. ACTION: Right engine oil pressure fluctuates @ idle. Installed new bullet type oil psi regulator P/N 857230 & compression spring P/N 838122 - OP's checked good.	119.00	119.00T
0.33	Shop Discrepancy	DISCREPANCY: RH primer weak / possibly inoperable. ACTION: OP's checked RH engine primer - OP's checked good. Inspected and found particles in fuel. Pumped primer to clear - OP's checked good.	119.00	39.27T
1	Supplies	Assembly Supplies, Solvents, lubricants & Sealants	30.00	30.00T
1	Flight Test	Complimentary Flight Test	0.00	0.00T
		Parts Invoices: LAC 11302 LAS 153218 Sales Tax	0.00	0.00

Total \$10,514.09