

Date

Total Time

CARRIED FORWARD

wo: 1841



FFM

FLORIDA FLIGHT MAINTENANCE

Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 941-485-1149

June 01, 2022

N46545
hobbs: 3365.1

Lycoming, 0-360-A4A, S/N: L-10486-36A
tach: 573.1 SMOH: 2254.0

50 HOUR ENGINE INSPECTION IAW FFM CHECKLIST. CHANGED OIL AND FILTER AA48110-2, SERVICED ENGINE WITH 6 QTS OF AEROSHELL W100 PLUS. REPLACED ENGINE AIR FILTER, NEXT DUE TACH 673. Installed (1 EA) P/N BA-6108 - Brackett Air Filter.
OPERATIONAL CHECK IS SATISFACTORY. Details of work performed are on file with Florida Flight Maintenance under work order: 1841.

Mark Lamb

Mark Lamb A & P 3205971

AIRFRAME - page 1 of 1

wo: 2032



FFM

FLORIDA FLIGHT MAINTENANCE

Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 941-485-1149

August 18, 2022

N46545
hobbs: 3365.1

CESSNA, 172K, S/N: 17257341
tach: 626.0 TTSN: 4309.9

R/R OIL AND FILTER WITH CUSTOMER SUPPLIED AEROSHELL W100 PLUS AND FILTER.
OPERATIONAL CHECK IS SATISFACTORY. Details of work performed are on file with Florida Flight Maintenance under work order: 2032.

Josh Hapner

Josh Hapner A&P 4417276

11/25/2022 N46545 Lycoming 0-360-A4A S/N: L-10486-36A Tach: 684.5 TSMOH: 2,365.4

Inspected this Engine I/A/W Annual Inspection Guidelines and Cessna M/M. Comp: 1) 73/80, 2) 75/80, 3) 76/80 4) 72/80. R/R oil with 8 qts. Phillips 20/50. R/R oil filter. Cleaned and inspected spark plugs. Checked magneto timing. No AD's due at this time. Ops and leak checks good. This Engine is determined to be in Airworthy Condition at this time.

Hampton Lide
Hampton Lide AP3600683IA

01/21/2023 N46545 Lycoming 0-360-A4A S/N: L-10486-36A Tach: 708.2 TSMOH: 2,389.1

Inspected this Engine I/A/W Annual Inspection Guidelines and Cessna M/M. Comp: 1) 75/80, 2) 73/80, 3) 75/80 4) 76/80. R/R oil with 8 qts. Aero Shell. R/R oil filter. Cleaned and inspected spark plugs. R/R Carburetor, Installed P/N: MA-4-5, S/N: MS11CX10. Repaired carb box. Re-flared primer line and secured. Ops and leak check good. Checked magneto timing. No AD's due at this time. Ops and leak checks good. This Engine is determined to be in Airworthy Condition at this time.

Hampton Lide
Hampton Lide AP3600683IA

05/04/2023 N46545 Lycoming 0-360-A4A S/N: L-10486-36A Tach: 805.0 TSMOH: 2,485.9

Inspected this Engine I/A/W 100hr Inspection Guidelines and Cessna M/M. Comp: 1) 79/80, 2) 72/80, 3) 76/80 4) 73/80. R/R oil with 8 qts. Phillips 20/50. R/R oil filter. Cleaned and inspected spark plugs. Checked magneto timing. No AD's due at this time. Ops and leak checks good. This Engine is determined to be in Airworthy Condition at this time.


Hampton Lide
Hampton Lide AP3600683IA

AIRCRAFT MAINTENANCE RECORD

Page No. _____

Date	Total Time	DESCRIPTION OF WORK PERFORMED
SIGNATURE & CERTIFICATE NUMBER OF PERSON PERFORMING WORK		

wo: 1092 ENGINE - page 1 of 1




FFM
FLORIDA FLIGHT MAINTENANCE

Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 9253953333


N46545 **Lycoming, 0-360-A4A, S/N: L-10486-36A** **September 29, 2021**
 hobbs: 3202.9 tach: 440.8 SMOH: 2121.7

1. OIL AND FILTER CHANGE. Installed P/N AA48110-2 - OIL FILTER.

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH APPLICABLE MAINTENANCE MANUALS Details of work performed are on file with Florida Flight Maintenance under work order: 1092.

Josh Hapner A&P 4417276 

wo: 1280 ENGINE - page 1 of 1



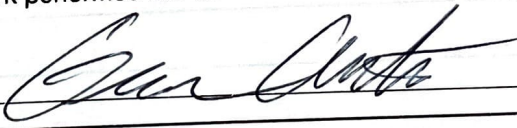
FFM
FLORIDA FLIGHT MAINTENANCE

Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 941-485-1149


N46545 **Lycoming, 0-360-A4A, S/N: L-10486-36A** **December 10, 2021**
 hobbs: 3247.4 tach: 476.7 SMOH: 2157.6

1. 100 HOUR ENGINE INSPECTION IAW MANUFACTURES CHECKLIST. RAN ENGINE, REMOVED COWLING, DRAINED OIL, CUT OIL FILTER AND PULLED SUMP SCREEN. CYLINDER COMPRESSION #1 72/80, #2 74/80. #3 78/80, #4 73/80. INSTALLED NEW OIL FILTER, SERVICED ENGINE WITH 8 QTS OF AEROSHELL W100 PLUS OIL. CLEAN/GAP/TEST SPARK PLUGS AND CHECKED MAGNETO TIMING. VERIFIED APPLICABLE AD COMPLIANCE THROUGH T-DATA 2021-25. DE-GREASED ENGINE, RAN FOR LEAKS OPERATION CHECK. REINSTALLED COWLING. I CERTIFY THIS ENGINE HAS BEEN INSPECTED IAW AN 100 HOUR INSPECTION AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION. Installed (1 EA) P/N AA48110-2 - OIL FILTER, Installed P/N BA-6108 - Brackett Air Filter.

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH APPLICABLE MAINTENANCE MANUALS Details of work performed are on file with Florida Flight Maintenance under work order: 1280.

Gene Antini Airframe & Powerplant I.A. 57503505 

wo: 1578 ENGINE - page 1 of 1




FFM
FLORIDA FLIGHT MAINTENANCE

Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 941-485-1149

N46545 **Lycoming, 0-360-A4A, S/N: L-10486-36A** **March 08, 2022**
 hobbs: 3305.6 tach: 524.4 SMOH: 2205.3

50 HOUR ENGINE INSPECTION IAW MANUFACTURES CHECKLIST. CHANGED OIL AND FILTER, SERVICED ENGINE WITH 8 QTS OF AEROSHELL W100. CLEAN/GAP/TEST SPARK PLUGS. Installed (1 EA) P/N AA48110-2 - OIL FILTER.

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH APPLICABLE MAINTENANCE MANUALS Details of work performed are on file with Florida Flight Maintenance under work order: 1578.

Mark Lamb A & P 3205971 

SUB-TOTAL THIS PAGE
 FORWARD TO NEXT PAGE

AIRCRAFT MAINTENANCE RECORD

Page No. _____

Date _____ Total Time _____ DESCRIPTION OF WORK PERFORMED
SIGNATURE & CERTIFICATE NUMBER OF PERSON PERFORMING WORK

CA FOR

wo: 0538

ENGINE - page 1 of 1



Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 9253953333

N46545 **Lycoming, 0-360-A4A, S/N: L-10486-36A** **February 16, 2021**
hobbs: 3036.7 tach: 312.2 SMOH: 1993.1

1. 25 HOUR BREAK-IN OIL AND FILTER CHANGE. REMOVED CLEAN/GAP/TEST SPARK PLUGS AND REINSTALL. Installed (8) Aeroshell 100 (BREAK IN) - Oil (Mineral), Installed (1) AA48110-2 - OIL FILTER.

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH APPLICABLE MAINTENANCE MANUALS Details of work performed are on file with Florida Flight Maintenance under work order: 0538.

Josh Hapner A&P 4417276

Josh Hapner

wo: 0625

ENGINE - page 1 of 1



Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 9253953333

N46545 **Lycoming, 0-360-A4A, S/N: L-10486-36A** **April 2, 2021**
hobbs: 3003.6 tach: 287.0 SMOH: 1967.9

1. OIL AND FILTER CHANGE Installed (8) Aeroshell w100 Plus - Aeroshell w100 Plus, Installed (1) AA48110-2 - OIL FILTER.

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH APPLICABLE MAINTENANCE MANUALS Details of work performed are on file with Florida Flight Maintenance under work order: 0625.

Josh Hapner A&P 4417276

Josh Hapner

wo: 0791

ENGINE - page 1 of 1



Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 9253953333

N46545 **Lycoming, 0-360-A4A, S/N: L-10486-36A** **June 16, 2021**
hobbs: 3003.6 tach: ~~287.0~~ 388.0 SMOH: ~~1967.9~~ 2067.0

1. ENGINE OIL AND FILTER CHANGE. AEROSHELL W100 PLUS 8 QTS. REMOVE CLEAN/GAP/TEST SPARK PLUGS. R/R INDUCTION AIR FILTER; Installed (1) AA48110-2 - OIL FILTER, Installed (1) BA-6108 - Brackett Air Filter.

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH APPLICABLE MAINTENANCE MANUALS Details of work performed are on file with Florida Flight Maintenance under work order: 0791.

Mark Lamb A & P 3205971

Mark Lamb

SUB-TOTAL THIS PAGE

AIRCRAFT MAINTENANCE RECORD

Page No. _____

Date
CARRIED FORWARD →

Total Time

DESCRIPTION OF WORK PERFORMED
SIGNATURE & CERTIFICATE NUMBER OF PERSON PERFORMING WORK

wo: 0106



AIRFRAME - page 1 of 1

Florida Flight Maintenance - 160 East Airport Ave - Venice, FL 34285 - 9416001791

N46545
Tach: 284.7

Cessna, 172K, S/N: 17257341
TTSN: 3968.6 Hobbs: 2999.8

May 21, 2020

REMOVE COWLING FIND OIL LEAK. REMOVE AND REPLACE ALL OIL RETURN LINE TUBES RE TORQUE CASE BOLTS TO FACTORY SPECS TIGHTEN VALVE COVER GASKETS DE-GREASE ENGINE RUN FOR LEAK OPERATIONS CHECK REINSTALL COWLING.

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: 0106.

Gene Antini Airframe & Powerplant I.A. 57503505 *[Signature]*

wo: 0113



AIRFRAME - page 1 of 1

Florida Flight Maintenance - 160 East Airport Ave - Venice, FL 34285 - 9413001791

N46545
Tach: 284.7

Cessna, 172K, S/N: 17257341
TTSN: 3968.6 Hobbs: 2999.8

May 28, 2020

REPLACED CARB HEAT SHIELD.

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: 0113.

Stephen LaGrand Airframe & Powerplant 3691597 *[Signature]*

wo: 0392



ENGINE - page 1 of 1

Florida Flight Maintenance - 160 East Airport Ave - Venice, FL 34285 - 9253953333

N46545
tach: 287.0

Lycoming, O-360-A4A, S/N: L-10486-36A
SMOH: 1967.9 hobbs: 3003.6

November 30, 2020

1. RAN ENGINE, REMOVED COWLING, DRAINED OIL, CUT OIL FILTER, NO METAL NOTED, CHECKED SUMP SCREEN, INSTALLED NEW OIL FILTER, CLEAN/GAP/TEST SPARK PLUGS. REMOVED AND HONED CYLINDERS, R/R PISTON RINGS. SERVICED ENGINE WITH 8 QTS OF AEROSHELL 100 OIL, CLEANED, DEGREASED, AND LUBED PER MANUFACTURES CHECKLIST, RAN FOR LEAKS OPERATION CHECK, REINSTALLED COWLING. CONDUCTED POST MAINTENANCE CHECK FLIGHT AND CYLINDER BREAK-IN (2.4 HRS). CHECKED AD COMPLIANCE THROUGH T-DATA BI WEEKLY 2020-20. I CERTIFY THIS ENGINE HAS BEEN INSPECTED IAW A 100 HOUR INSPECTION AND DETERMINED TO BE AIRWORTHY.

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH APPLICABLE MAINTENANCE MANUALS Details of work performed are on file with Florida Flight Maintenance under work order: 0392.

Gene Antini Airframe & Powerplant I.A. 57503505 *[Signature]*

Date

Total Time

CARRIED FORWARD →

ENGINE - page 1 of 1

wo: WO_728



Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 9416001791

February 25, 2020

N46545
Tach: 235.1

1. PERFORMED 50 HOUR ENGINE INSPECTION IAW MANUFACTURES CHECKLIST. Installed (1) AA48110-2 - OIL FILTER, Installed (8) Aeroshell W100 (quart) - Aeroshell W100 Oil.

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH APPLICABLE MAINTENANCE MANUALS Details of work performed are on file with Florida Flight Maintenance under work order: WO_728.

Gene Antini Airframe & Powerplant I.A. 57503505

wo: 00015

AIRFRAME - page 1 of 1

ENG. EST. TT
1957.2 @



Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 9416001791

March 18, 2020

N46545
Tach: 276.3

Hobbs: 2988.8

R/R VACUUM PUMP Installed (1) 215CC - Vacuum Pump, S/N: 0ACV03.

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: 00015.

Gene Antini Airframe & Powerplant I.A. 57503505

wo: 00047

ENGINE - page 1 of 1



Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 9416001791

N46545
Tach: 284.7

Hobbs: 2999.8

April 13, 2020

1. RAN ENGINE, REMOVED COWLING, COMPRESSION: #1 76/80, #2 76/80, #3 78/80, #4 78/80. DRAINED OIL, CUT OIL FILTER, NO METAL NOTED, CHECKED SUMP SCREEN, INSTALLED NEW OIL FILTER, CLEAN/GAP/TEST SPARK PLUGS, SERVICED ENGINE WITH 8 QTS OF AEROSHELL W100 OIL, CLEANED, DEGREASED, AND LUBED PER MANUFACTURES CHECKLIST, RAN FOR LEAKS OPERATION CHECK, REINSTALLED COWLING, I CERTIFY THIS ENGINE HAS BENN INSPECTED IAW A100 HOUR INSPECTION AND DETERMINED AIRWORTHY AT THIS TIME. Installed (1) AA48110-2 - OIL FILTER, Installed (8) Aeroshell W100 (quart) - Aeroshell W100 Oil, Installed (1) BA-4108 - BRACKETT AIR FILTER.

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH APPLICABLE MAINTENANCE MANUALS Details of work performed are on file with Florida Flight Maintenance under work order: 00047.

Stephen LaGrand Airframe & Powerplant 3691597

Date

Total Time

DESCRIPTION OF WORK PERFORMED
SIGNATURE & CERTIFICATE NUMBER OF PERSON PERFORMING WORK

CARRIED FORWARD →

wo: WO_646

ENGINE - page 1 of 1



Florida Flight Maintenance - 160 East Airport Ave - Venice, FL 34285 - 9416001791

January 24, 2020

N46545
Tach: 193.4

Hobbs: 2871.8

1. RAN ENGINE, REMOVED COWLING, COMPRESSION: #1 76/80, #2 74/80, #3 79/80, #4 80/80. DRAINED OIL, CUT OIL FILTER, NO METAL NOTED, CHECKED SUMP SCREEN, INSTALLED NEW OIL FILTER, CLEANED GAPPED AND TESTED SPARK PLUGS, SERVICED ENGINE WITH 8 QTS OF AEROSHELL W100 OIL, CLEANED, DEGREASED, AND LUBED PER MANUFACTURES CHECKLIST, RAN FOR LEAKS OPERATION CHECK, REINSTALLED COWLING, I CERTIFY THIS ENGINE HAS BENN INSPECTED IAW AN ANNUAL INSPECTION AND DETERMINED AIRWORTHY AT THIS TIME. Installed (1) BA-4108 - BRACKETT AIR FILTER, Installed (1) AA48110-2 - OIL FILTER, Installed (8) Aeroshell W100 (quart) - Aeroshell W100 Oil.

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH APPLICABLE MAINTENANCE MANUALS Details of work performed are on file with Florida Flight Maintenance under work order: WO_646.

Gene Antini Airframe & Powerplant I.A. 57503505

wo: WO_649

AIRFRAME - page 1 of 1



Florida Flight Maintenance - 160 East Airport Ave - Venice, FL 34285 - 9416001791

January 25, 2020

N46545
Tach: 195.5

Hobbs: 2875.4

REMOVED, CLEANED AND REPLACED LOWER SPARK PLUGS IAW C172 MM Installed (4) REM38E - SPARKPLUG.

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: WO_649.

Stephen LaGrand Airframe & Powerplant 3691597

wo: WO_652

ENGINE - page 1 of 1



Florida Flight Maintenance - 160 East Airport Ave - Venice, FL 34285 - 9416001791

January 30, 2020

N46545
Tach: 204.0

TROUBLESHOOT ACFT AT KOBE, PREFLIGHT AND MAG/STATIC RPM CHECK IAW POH. FLEW ACFT BACK TO KVNC 1.5 HOURS.

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH APPLICABLE MAINTENANCE MANUALS Details of work performed are on file with Florida Flight Maintenance under work order: WO_652.

ANDRE GHAWI AIRFRAME & POWERPLANT 3906573

TOTAL - CARRY FORWARD TO NEXT PAGE

AIRCRAFT MAINTENANCE RECORD

Page No. _____

Date	Total Time	DESCRIPTION OF WORK PERFORMED SIGNATURE & CERTIFICATE NUMBER OF PERSON PERFORMING WORK
------	------------	---

CARRIED FORWARD →

wo: WO_602



AIRFRAME - page 1 of 1

Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 8416001791

N46545
Tach: 159.9

January 2, 2020

THREE WASHER INSTALLED IN THE OIL PRESSURE SENDER. OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: WO_602.

Gene Antini Airframe & Powerplant I.A. 57503505

wo: WO_610



ENGINE - page 1 of 1

Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 8416001791

N46545
Tach: 161.2

January 7, 2020

STARTER FAILED. R/R STARTER. Installed (1) 149-NL - Sky-Tec Starter, S/N: H-T101999. OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH APPLICABLE MAINTENANCE MANUALS Details of work performed are on file with Florida Flight Maintenance under work order: WO_610.

Gene Antini Airframe & Powerplant I.A. 57503505

wo: WO_639



ENGINE - page 1 of 1

Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 8416001791

N46545
Tach: 186.2

Hobbs: 2862.4

January 20, 2020

R/R SPARK PLUGS. REPAIRED CARB HEAT DAMPER FITTINGS TO CLOSE GAP IN AIR BOX. STATIC RPM >2300.

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH APPLICABLE MAINTENANCE MANUALS Details of work performed are on file with Florida Flight Maintenance under work order: WO_639.

Gene Antini Airframe & Powerplant I.A. 57503505



Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 9416001791

N46545
Tach: 142.9

December 16, 2019

1. RAN FOR MAG CHECK, REMOVED, CLEANED AND REINSTALLED SPARK PLUGS, OPS CHECK GOOD.

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH APPLICABLE MAINTENANCE MANUALS Details of work performed are on file with Florida Flight Maintenance under work order: WO_558.

Gene Antini Airframe & Powerplant I.A. 57503505



Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 9416001791

N46545
Tach: 151.0

December 23, 2019

1. PERFORMED ENGINE INSPECTION IAW MANUFACTURES CHECKLIST. Installed (7) Aeroshell W100 (quart) - Aeroshell W100 Oil.

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH APPLICABLE MAINTENANCE MANUALS Details of work performed are on file with Florida Flight Maintenance under work order: WO_580.

Stephen LaGrand Airframe & Powerplant 3691587



Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 9416001791

N46545
Tach: 152.2

December 26, 2019

R/R SPARK PLUGS AND CHECK TIMING. CARB HEAT NOT CLOSING. ADJUSTED CARB HEAT FLAP-PER VALVE TO CLOSE. STATIC RPM 2330. PMCF >2400 RPM ON T/OFF ROLL. OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH APPLICABLE MAINTENANCE MANUALS Details of work performed are on file with Florida Flight Maintenance under work order: WO_584.

Gene Antini Airframe & Powerplant I.A. 57503505

SUB-TOTAL THIS PAGE


TOTAL - CARRY FORWARD TO NEXT PAGE

AIRCRAFT MAINTENANCE RECORD

Page No. _____

Date	Total Time	DESCRIPTION OF WORK PERFORMED SIGNATURE & CERTIFICATE NUMBER OF PERSON PERFORMING WORK
CARRIED FORWARD →		

wo: WO_502 ENGINE - page 1 of 1




FFM
FLORIDA FLIGHT MAINTENANCE

Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285


N46545 **November 23, 2019**
Tach: 98.3

1. RAN ENGINE, REMOVED COWLING, COMPRESSION WAS 72/80 OR MORE ON ALL CYLINDERS, DRAINED OIL, CUT OIL FILTER, NO METAL NOTED, CHECKED SUMP SCREEN, INSTALLED NEW OIL FILTER, CLEANED GAPPED AND TESTED SPARK PLUGS, SERVICED ENGINE WITH 8 QTS OF AEROSHELL W100 OIL, CLEANED, DEGREASED, AND LUBED PER MANUFACTURES CHECKLIST, RAN FOR LEAKS OPERATION CHECK, REINSTALLED COWLING, CERTIFY THIS ENGINE HAS BENN INSPECTED IAW AN 100 HOUR INSPECTION AND DETERMINED AIRWORTHY AT THIS TIME. Installed (1) 10-01333 - AIR FILTER, GARTER, Installed (1) BA6108 - Brackett Air Filter, Installed (8) Aeroshell W100 (quart) - Aeroshell W100 Oil, Installed (1) AA48110-2 - OIL FILTER.

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH APPLICABLE MAINTENANCE MANUALS Details of work performed are on file with Florida Flight Maintenance under work order: WO_502.

Stephen LaGrand Airframe & Powerplant 3691597 

wo: WO_510 ENGINE - page 1 of 1




FFM
FLORIDA FLIGHT MAINTENANCE


Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285

N46545 **November 25, 2019**
Tach: 100.7

FOUND #2 PLUG OIL FOULED. R/R PLUGS, COMPRESSION CHECK, MAGNETO CHECK. OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH APPLICABLE MAINTENANCE MANUALS Details of work performed are on file with Florida Flight Maintenance under work order: WO_510.

Gene Antini Airframe & Powerplant I.A. 57503505 

wo: WO_524 AIRFRAME - page 1 of 1




FFM
FLORIDA FLIGHT MAINTENANCE

Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285

N46545 **December 2, 2019**
Tach: 119.6

REMOVE OIL PRESSURE SENDER. REMOVED TWO OF FOUR WASHERS. OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: WO_524.

Gene Antini Airframe & Powerplant I.A. 57503505 

	SUB-TOTAL THIS PAGE
	TOTAL - CARRY FORWARD TO NEXT PAGE


AIRCRAFT MAINTENANCE RECORD Page No. _____


Date	Total Time	DESCRIPTION OF WORK PERFORMED SIGNATURE & CERTIFICATE NUMBER OF PERSON PERFORMING WORK
------	------------	---

23/09/19 OLD TACH:1687.9

23/09/19 NEW TACH:0

wo: 2019-891	 FFM <small>FLORIDA FLIGHT MAINTENANCE</small> Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285	Engine - page 1 of 1
<p><i>ENG. EST. T.T.</i> <i>1706.29</i></p>		
N46545 Tach: 25.3		October 27, 2019
<p>CLEANED, GAPPED AND TESTED SPARK PLUGS, OPS CHECK GOOD. OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH APPLICABLE MAINTENANCE MANUALS Details of work performed are on file with Florida Flight Maintenance under work order: 2019-891.</p>		
Gene Antini Airframe & Powerplant I.A. 57503505 <i>Gene Antini</i>		

wo: WO_459	 FFM <small>FLORIDA FLIGHT MAINTENANCE</small> Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285	Airframe - page 1 of 1
N46545 Tach: 60.7	CESSNA, 172K, S/N: 17257341	November 6, 2019
<p>R/R SPARK PLUGS, CLEANED, SET GAP AND TESTED. FOUND TWO BAD PLUGS. Installed (2) REM38E - SPARKPLUG. OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: WO_459.</p>		
Gene Antini Airframe & Powerplant I.A. 57503505 <i>Gene Antini</i>		

wo: WO_473	 FFM <small>FLORIDA FLIGHT MAINTENANCE</small> Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285	Engine - page 1 of 1
N46545 Tach: 70.2		November 9, 2019
<p>CLEANED, GAPPED AND TESTED SPARK PLUGS, OPS CHECK GOOD. OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH APPLICABLE MAINTENANCE MANUALS Details of work performed are on file with Florida Flight Maintenance under work order: WO_473.</p>		
Gene Antini Airframe & Powerplant I.A. 57503505 <i>Gene Antini</i>		

	SUB-TOTAL THIS PAGE
	TOTAL - CARRY FORWARD TO NEXT PAGE

AIRCRAFT MAINTENANCE RECORD

Page No. _____

Date	Total Time	DESCRIPTION OF WORK PERFORMED SIGNATURE & CERTIFICATE NUMBER OF PERSON PERFORMING WORK
CARRIED FORWARD →		

wo: WO_447

USE THIS FOR NEW AVIONICS INSTALLATIONS - page 1 of 1



FFM
FLORIDA FLIGHT MAINTENANCE

Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285

N46545
Tach: 53.5


November 4, 2019

REMOVED AND REPLACED RADIO WITH UNIT FROM INVENTORY IAW C152 MM. Installed (1) 03118-301 - NAV/COM. OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH APPLICABLE MAINTENANCE MANUALS Details of work performed are on file with Florida Flight Maintenance under work order: WO_447.

Stephen LaGrand Airframe & Powerplant 3691597

wo: WO_438

Airframe · page 1 of 1



FFM
FLORIDA FLIGHT MAINTENANCE

Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285

N46545
Tach: 52.3

November 5, 2019


CESSNA, 172K, S/N: 17257341

INVESTIGATED BURNING SMELL IN CABIN. ISOLATED TO NARCO 12C RADIO. IT WILL XMIT BUT NO RECEIVE. SENT TO BE REPAIRED. SEE WO-447. OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: WO_438.

Gene Antini Airframe & Powerplant I.A. 57503505

wo: WO_513

AVIONICS · page 1 of 1



FFM
FLORIDA FLIGHT MAINTENANCE

Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285

N46545
Tach: 103.5


November 26, 2019

INSPECTED PITOT STATIC SYSTEM, CLEANED CONNECTIONS AND RESET XPONDER. ALT INDICATION IS ON. OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH APPLICABLE MAINTENANCE MANUALS Details of work performed are on file with Florida Flight Maintenance under work order: WO_513.

Gene Antini Airframe & Powerplant I.A. 57503505

wo: WO_525

AVIONICS · page 1 of 1



FFM
FLORIDA FLIGHT MAINTENANCE

Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285

N46545
Tach: 119.6

December 2, 2019

INSTALL SKYBEACON ADS-B IAW C172 MM Installed (1) 11-16531 - SKYBEACON, ADS-B, S/N: 1008595. OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH APPLICABLE MAINTENANCE MANUALS Details of work performed are on file with Florida Flight Maintenance under work order: WO_525.

Stephen LaGrand Airframe & Powerplant 3691597