



11/25/2022

N46545

C-172K

S/N: 17257341

Tach: 684.5

Total: 4368.4

Inspected this Aircraft I/A/W Annual Inspection Guidelines and Cessna M/M. Inspected ELT I/A/W FAR91.207(d). Battery due: NOV 2023. Complied with AD72-03-03 Flap Jackscrew. Complied with AD2011-10-09 Seat Rails. Complied with AD72-07-02 Placard. Complied with AD2008-26-10 Decal. Lubed flight control cables. Inspected all wheel and brake assy. Removed Antenna from upper fuselage and patched hole. Leak and ops checked good. This Aircraft is determined to be in Airworthy Condition at this time.

*[Signature]*  
Hampton Lide AP36006831A

01/21/2023

N46545

C-172K

S/N: 17257341

Tach: 708.2

Total: 4392.1

Inspected this Aircraft I/A/W Annual Inspection Guidelines and Cessna M/M. Inspected ELT I/A/W FAR91.207(d). Battery due: NOV 2023. Complied with AD72-03-03 Flap Jackscrew. Complied with AD2011-10-09 Seat Rails. Complied with AD72-07-02 Placard. Complied with AD2008-26-10 Decal. Lubed flight control cables. Inspected all wheel and brake assy. Leak and ops checked good. This Aircraft is determined to be in Airworthy Condition at this time.

*[Signature]*  
Hampton Lide AP36006831A

04/11/23 Remove and replace Left Inner-tube p/n 06-00365 and tire p/n 6.00-6 4/072-315-0 and Right Inner-tube p/n 06-00365 and tire p/n 6.00-6 4/072-315-0. *[Signature]* Mark Lynn 272182

**Propelling Aviation**

Propelling Aviation, LLC, 380 Airport Lane, Tazewell TN 37879  
Date: 04-20-2023 Logbook: Airframe Tail Number: N46545  
Tach: Model: 172K Serial: 17257341

Repairs / Maintenance

- The transponder tests required by 14 CFR 91.413 have been performed and found to comply with 14 CFR part 43, Appendix F. Transponder PN 011-00490-00 SN: 83726964.

Pertinent Details Of This Repair Are on File Under Work Order No. 226

Certificate: PANR091E | Authorized RTS Technician

Sign: *[Signature]* | Date: 04-20-2023

05/04/2023

N46545

C-172K

S/N: 17257341

Tach: 805.0

Total: 4488.9

Inspected this Aircraft I/A/W 100hr. Inspection Guidelines and Cessna M/M. Inspected ELT I/A/W FAR91.207(d). Battery due: NOV 2023. Complied with AD72-03-03 Flap Jackscrew. Complied with AD2011-10-09 Seat Rails. Complied with AD72-07-02 Placard. Complied with AD2008-26-10 Decal. Lubed flight control cables. Inspected all wheel and brake assy. R/R several engine cowling brackets. R/R grease felt pads on nose gear wheel. R/R L/H and R/H Fuel Tanks. Leak and ops check good. This Aircraft is determined to be in Airworthy Condition at this time.

*[Signature]*  
Hampton Lide AP36006831A

# AIRCRAFT MAINTENANCE RECORD

Page No. \_\_\_\_\_

Date

Total Time

DESCRIPTION OF WORK PERFORMED  
SIGNATURE & CERTIFICATE NUMBER OF PERSON PERFORMING WORK

AIRFRAME - page 1 of 1

CA FOR

wo: 1578



Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 941-485-1149

March 08, 2022

N46545  
hobbs: 3305.6

CESSNA, 172K, S/N: 17257341  
tach: 524.4 TTSN: 4208.3

50 HOUR AIRFRAME INSPECTION IAW MANUFACTURES CHECKLIST. ADJUSTED NOSE WHEEL STEERING TUBES.

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: 1578.

Mark Lamb A & P 3205971

AIRFRAME - page 1 of 1

wo: 1646



Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 941-485-1149

April 04, 2022

N46545  
hobbs: 3336.8

CESSNA, 172K, S/N: 17257341  
tach: 550.5 TTSN: 4234.4

1. REMOVE AND REPLACE BOTH NOSE WHEEL STEERING RODS. Installed (1 EA) P/N MC0543022-1 - TUBE, STEERING, LEFT, Installed (1 EA) P/N MC0543022-2 - TUBE, STEERING, RIGHT.
2. R/R LEFT MLG TIRE Installed (1 EA) P/N 06-01472 - RETREAD TIRE STD 600-6 6 PLY (OVERHAULED) S/N: 91555827.

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: 1646.

Gene Antini Airframe & Powerplant I.A. 57503505

AIRFRAME - page 1 of 1

wo: 1841



Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 941-485-1149

June 01, 2022

N46545  
hobbs: 3365.1

CESSNA, 172K, S/N: 17257341  
tach: 573.1 TTSN: 4257.0

50 HOUR AIRFRAME INSPECTION IAW FFM CHECKLIST.

OPERATIONAL CHECK IS SATISFACTORY. Details of work performed are on file with Florida Flight Maintenance under work order: 1841.

Mark Lamb A & P 3205971

wo: 2180



Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 941-485-1149

AIRFRAME - page 1 of 1

N46545  
hobbs: 3365.1

CESSNA, 172K, S/N: 17257341  
tach: 573.1 TTSN: 4257.0

October 25, 2022

R/R NOSE TIRE TUBE Installed P/N 097-908-C - MICHELIN 5.00-5 TUBE.

OPERATIONAL CHECK IS SATISFACTORY. Details of work performed are on file with Florida Flight Maintenance under work order: 2180.

NICHOLAS SZYMCZYK A&P 4631548

wo: 0791

AIRFRAME - page 1 of 1



Florida Flight Maintenance - 160 East Airport Ave - Venice, FL 34285 - 9253953333

**N46545**

hobbs: 3133.4

**CESSNA, 172K, S/N: 17257341**

tach: 388.0

TTSN: 4071.9

**June 16, 2021**

1. R/R BROKEN COWLING FASTENERS X2.. Installed (1) SK2003-42A - Cowling Mount (Skybolt), Installed (1) SK2003-42A - Cowling Mount (Skybolt).

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: 0791.

Mark Lamb A &amp; P 3205971

wo: 1092

AIRFRAME - page 1 of 1



Florida Flight Maintenance - 160 East Airport Ave - Venice, FL 34285 - 9253953333

**N46545**

hobbs: 3202.9

**CESSNA, 172K, S/N: 17257341**

tach: 440.8

TTSN: 4124.7

**September 29, 2021**

1. REPAIRED BROKEN LOWER RIGHT COWLING SUPPORT. Installed P/N SK2003-42A - Cowling Mount (Skybolt).

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: 1092.

Jason Woodling A &amp; P 12345678

Pending

wo: 1280

AIRFRAME - page 1 of 1



Florida Flight Maintenance - 160 East Airport Ave - Venice, FL 34285 - 941-485-1149

**N46545**

hobbs: 3247.4

**CESSNA, 172K, S/N: 17257341**

tach: 476.7

TTSN: 4160.6

**December 10, 2021**

1. ANNUAL INSPECTION IAW MANUFACTURES CHECKLIST. OPENED PANELS, LUBED AND INSPECTED COMPLIED WITH COMPLIED WITH AD 72-03-03 FLAP JACK SCREW, 72-07-02 PLACARD, 2008-26-10 DECAL, 2011-10-09 SEAT RAILS (NEXT DUE TACH 576) BY INSPECTION. VERIFIED APPLICABLE AD COMPLIANCE THROUGH T-DATA 2021-24. ELT IAW FAR91.207(d), R/R ELT BATTERY DUE DATE: NOV 2023. REPLACED GARTER AIR FILTER AND INSTRUMENT AIR FILTER NEXT DUE TACH 976. REINSTALLED PANELS, I CERTIFY THIS AIRCRAFT HAS BEEN INSPECTED IAW MMM ANNUAL INSPECTION AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION. Installed (1 EA) P/N 10-01333 - AIR FILTER; GARTER , Installed P/N AAD9-14-5 - PNEUMATIC FILTERS , Installed (1 EA) P/N BP-1010 - ELT Battery , Installed P/N 13-17904 - LICENSE HOLDER 7.5 X 8.
2. REPAIR FOUR BROKEN COWLING SUPPORT BRACKETS AND FASTENERS. Installed (2) P/N SK2003-42A - Cowling Mount (Skybolt) , Installed (1 EA) P/N SK2003-42A - Cowling Mount (Skybolt) , Installed (1 EA) P/N SK2003-42A - Cowling Mount (Skybolt).
3. Removed and flushed tachometer cable of excessive oil. Needs engine TACH drive seal.
4. R/R LEFT MLG BRAKE PADS. Installed (2 EA) P/N RA66-105 - Brake Lining.
5. REPLACED ENGINE OIL COOLER HOSES Installed (6) P/N 303-6 - HOSE, AEROQUIP, ID 5/16.
6. REMOVE AND CLEAN THE FUEL SELECTOR VALVE ASSEMBLY. PRESSURE TEST UNIT AND REINSTALL. R/R LEAKING FUEL GASCOLATOR BOWL, AND ALL O-RINGS. Installed P/N 0756008-1 - BOWL , Installed P/N MS29513-138 - O-ring , Installed P/N MS29513-010 - O-Ring.
7. R/R LEAKING RIGHT MLG BRAKE DICK O-RING.

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: 1280.

Gene Antini Airframe &amp; Powerplant I.A. 57503505

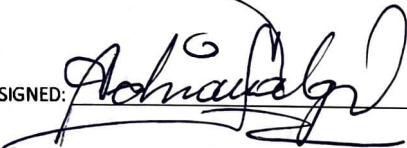
# AIRCRAFT MAINTENANCE RECORD

Page No. \_\_\_\_\_

Date	Total Time	DESCRIPTION OF WORK PERFORMED SIGNATURE & CERTIFICATE NUMBER OF PERSON PERFORMING WORK
------	------------	---


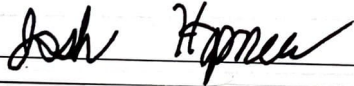
N46545 21 DEC 2020 HOBBS: 3004.7 WO# A9800FLR PAGE 1-1


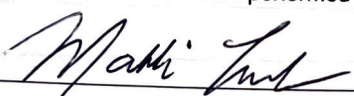
TESTED AND INSPECTED GARMIN GTX 327 TRANSPONDER PN: 011-00490-00 SN: 83726964 IAW 14 CFR 43 APPENDIX F AND FOUND TO COMPLY WITH 14 CFR 91.413.

SIGNED: 

DATE: 21-DEC-2020

APG Avionics CRS#N1OR037B - 8150 Skylane Way, Punta Gorda FL 33982  
+1 (941) 637-6530 <http://www.avionix.com>

wo: 0625	AIRFRAME - page 1 of 1	
 Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 9253953333		
N46545 hobbs: 3069.6	CESSNA, 172K, S/N: 17257341 tach: 337.9 TTSN: 4021.8	April 2, 2021
1. LANDING LIGHT INTERMITTENT.		
OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: 0625.		
Josh Hapner A&P 4417276		

wo: 0696	AIRFRAME - page 1 of 1	
 Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 9253953333		
N46545 hobbs: 3003.6	CESSNA, 172K, S/N: 17257341 tach: 287.0 TTSN: 3970.9	May 05, 2021
NOSE TIRE FLAT REMOVED AND REPLACED TUBE Installed (1) GL-5067B - INNER TUBE, 5.00 - 5, AERO CLASSIC.		
OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: 0696.		
Mark Lamb A & P 3205971		


**SUB-TOTAL** THIS PAGE

**TOTAL** - CARRY FORWARD TO NEXT PAGE


# AIRCRAFT MAINTENANCE RECORD

Page No. \_\_\_\_\_

Date	Total Time	DESCRIPTION OF WORK PERFORMED SIGNATURE & CERTIFICATE NUMBER OF PERSON PERFORMING WORK
------	------------	---

**CARRIED FOR**

wo: 0096 AIRFRAME - page 1 of 1



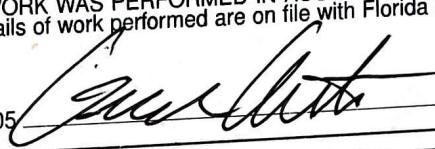
**FFM**  
FLORIDA FLIGHT MAINTENANCE

Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 9416001791


**N46545** **Cessna, 172K, S/N: 17257341** **June 29, 2020**  
 Tach: 284.7 TTSN: 3968.6 Hobbs: 2999.8

- PERFORMED CORROSION CONTROL ON AIRFRAME, CLEAN/TREAT/PAINT.
- REARRANGED AVIONICS STACK.
- REPAIRING INTERIOR PLASTIC PIECES Installed (1) P0500210-97 - C172K RH BAGGAGE COMPARTMENT.

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: 0096.

Gene Antini Airframe & Powerplant I.A. 57503505 

wo: 0392 AIRFRAME - page 1 of 1



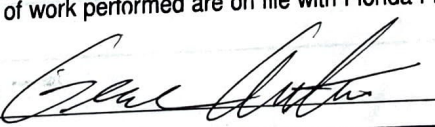
**FFM**  
FLORIDA FLIGHT MAINTENANCE

Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 9253953333

**N46545** **Cessna, 172K, S/N: 17257341** **November 30, 2020**  
 tach: 287.0 TTSN: 3970.9 hobbs: 3003.6

- OPENED PANELS, LUBED AND INSPECTED PER MANUFACTURES CHECKLIST. INSPECTED ELT IAW FAR 92.207(d). BATT DUE DEC-21. CHECKED CABLE TENSIONS, CHECKED AD COMPLIANCE THRU T-DATA BI-WEEKLY 2020-24, COMPLIED WITH AD 72-03-03 FLAP JACK SCREW, 72-07-02 PLACARD, 2008-26-10 DECAL, 2011-10-09 SEAT RAILS. REINSTALLED PANELS, I CERTIFY THIS AIRFRAME HAS BEEN INSPECTED IAW AN ANNUAL INSPECTION AND DETERMINED AIRWORTHY AT THIS TIME.

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: 0392.

Gene Antini Airframe & Powerplant I.A. 57503505 


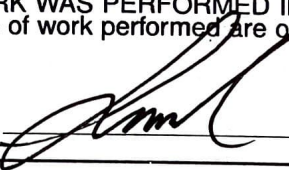

**SUB-TOTAL THIS PAGE**


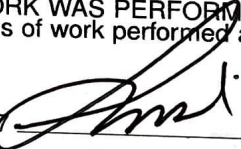
**TOTAL - CARRY FORWARD TO NEXT PAGE**


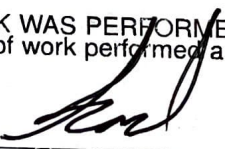
# AIRCRAFT MAINTENANCE RECORD

Date	Total Time	DESCRIPTION OF WORK PERFORMED SIGNATURE & CERTIFICATE NUMBER OF PERSON PERFORMING WORK
------	------------	---

CARRIED  
FORW

wo: 0101		AIRFRAME - page 1 of 1
 <p><b>FFM</b> FLORIDA FLIGHT MAINTENANCE</p> <p>Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 9416001791</p>		
<b>N46545</b> Tach: 284.7	<b>Cessna, 172K, S/N: 17257341</b> TTSN: 3968.6	<b>May 14, 2020</b>  REPAIRED BACK SEAT TOP.  OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: 0101.  Stephen LaGrand Airframe & Powerplant 3691597 

wo: 0103		AIRFRAME - page 1 of 1
 <p><b>FFM</b> FLORIDA FLIGHT MAINTENANCE</p> <p>Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 9416001791</p>		
<b>N46545</b> Tach: 284.7	<b>Cessna, 172K, S/N: 17257341</b> TTSN: 3968.6	<b>May 19, 2020</b>  FABRICATED COVER PLATE FOR GAP BELOW RADIO STACK.  OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: 0103.  Stephen LaGrand Airframe & Powerplant 3691597 

wo: 0105		AIRFRAME - page 1 of 1
 <p><b>FFM</b> FLORIDA FLIGHT MAINTENANCE</p> <p>Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 9416001791</p>		
<b>N46545</b> Tach: 284.7	<b>Cessna, 172K, S/N: 17257341</b> TTSN: 3968.6	<b>May 20, 2020</b>  REPAIRED LOWER COWLING CRACKS.  OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: 0105.  Stephen LaGrand Airframe & Powerplant 3691597 

	<b>SUB-TOTAL</b> THIS PAGE
	<b>TOTAL - CARRY FORWARD TO NEXT PAGE</b>

wo: WO\_728

AIRFRAME - page 1 of 1



Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 9416001791

N46545  
Tach: 235.1

February 25, 2020

1. PERFORMED 50 HOUR AIRFRAME INSPECTION IAW MANUFACTURES CHECKLISTED.

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: WO\_728.

Gene Antini Airframe &amp; Powerplant I.A. 57503505

wo: WO\_743

AIRFRAME - page 1 of 1



Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 9416001791

N46545  
Tach: 242.8

March 4, 2020

AFT.T. 3926.7

REMOVED AND REPLACED IGNITION SWITCH. P/N 10-357200 TCM

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: WO\_743.

Gene Antini Airframe &amp; Powerplant I.A. 57503505

wo: 00047

AIRFRAME - page 1 of 1



Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 9416001791

N46545  
Tach: 284.7

Hobbs: 2999.8

April 13, 2020

1. OPENED PANELS, LUBED AND INSPECTED PER MANUFACTURE'S CHECKLIST. INSPECTED ELT IAW FAR 92.207(d). BATT DUE: NOV 2021. CHECKED CABLE TENSIONS, CHECKED AD COMPLIANCE THRU CURRENT ISSUE, COMPLIED WITH AD 72-03-03 (FLAP JACK SCREWS), AND 2011-10-09 (SEAT TRACK RAILS). REINSTALLED PANELS, I CERTIFY THIS AIRFRAME HAS BEEN INSPECTED IAW A 100 HOUR INSPECTION AND DETERMINED AIRWORTHY AT THIS TIME. Installed (1) 10-01333 - AIR FILTER, GARTER, Installed (1) P0514012-1 - PANEL, LEFT REAR WINDOW, C-172K, Rev/Lot: 8190.

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: 00047.

Stephen LaGrand Airframe &amp; Powerplant 3691597

SUB-TOTAL THIS PAGE

TOTAL - CARRY FORWARD TO NEXT PAGE




# AIRCRAFT MAINTENANCE RECORD

Date	Total Time	DESCRIPTION OF WORK PERFORMED SIGNATURE & CERTIFICATE NUMBER OF PERSON PERFORMING WORK
------	------------	---

**CARRIED FORWARD** →

wo: WO\_668 AIRFRAME - page 1 of 1


 **FFM**  
FLORIDA FLIGHT MAINTENANCE

Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 9416001791


**N46545** **January 31, 2020**  
Tach: 209.4

REPLACED THE BROKEN PARKING BRAKE TUBE AND CABLE. Installed (1) 0713070-28 - PARKING BRAKE, TUBE & CABLE.

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: WO\_668.

Gene Antini Airframe & Powerplant I.A. 57503505 

wo: WO\_703 AIRFRAME - page 1 of 1


 **FFM**  
FLORIDA FLIGHT MAINTENANCE

Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 9416001791


**N46545** **February 13, 2020**  
Tach: 219.8

1. R/R LEFT TIRE Installed (1) n/a - 6.00 x 6/8 PLY TIRE, RETREADS, S/N: 81695843.
2. R/R STALL WARNING REED Installed (1) S2488-1 - Reed Valve, Stall Horn.

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: WO\_703.

Gene Antini Airframe & Powerplant I.A. 57503505 

wo: WO\_710 AIRFRAME - page 1 of 1


 **FFM**  
FLORIDA FLIGHT MAINTENANCE

Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 9416001791

**N46545** **February 17, 2020**  
Tach: 228.7

REPLACED FUSE, OPERATIONAL CHECK GOOD.

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: WO\_710.

Gene Antini Airframe & Powerplant I.A. 57503505 

	<b>SUB-TOTAL</b> THIS PAGE
	<b>TOTAL</b> - CARRY FORWARD TO NEXT PAGE

wo: WO\_822

AIRFRAME - page 1 of 1



Florida Flight Maintenance - 160 East Airport Ave - Venice, FL 34285 - 8416001791

N46545  
Tach: 165.4

January 9, 2020

R/R INOP TELEX TC200. Installed (1) TC200 TELEX - TELEX TC200 INTERCOM. OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: WO\_622.

Gene Antini Airframe & Powerplant I.A. 57503505

wo: WO\_640

AIRFRAME - page 1 of 1



Florida Flight Maintenance - 160 East Airport Ave - Venice, FL 34285 - 9416001791

N46545  
Tach: 186.2

Hobbs: 2862.4

January 20, 2020

REPAIRED BROKEN LOWER LEFT COWLING MOUNT SUPPORT IAW AC43.13-1B. OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: WO\_640.

Stephen LaGrand Airframe & Powerplant 3691597

wo: WO\_646

AIRFRAME - page 1 of 1



Florida Flight Maintenance - 160 East Airport Ave - Venice, FL 34285 - 9416001791

N46545  
Tach: 193.4

Hobbs: 2871.8

January 24, 2020

1. OPENED PANELS, LUBED AND INSPEXTEED PER MANUFACTURES CHECKLIST. INSPECTED ELT IAW FAR 92.207(d). CHECKED CABLE TENSIONS, CHECKED AD COMPLIANCE THRU CURRENT ISSUE, COMPLIED WITH AD 72-03-03, REINSTALLED PANELS. I CERTIFY THIS AIRFRAME HAS BEEN INSPECTED IAW AN ANNUAL INSPECTION AND DETERMINED AIRWORTHY AT THIS TIME. Installed (1) 10-01333 - AIR FILTER, GARTER.
2. REMOVED THE REAR SEAT AND WELD REPAIRED A BROKEN FRAME TUBE. REINSTALLED REAR SEAT.
3. R/R WORN LEFT MAIN TIRE Installed (1) n/a - 6.00 x 6/8 PLY TIRE, RETREADS, S/N: 80312259.

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: WO\_646.

Gene Antini Airframe & Powerplant I.A. 57503505

SUB-TOTAL THIS PAGE

TOTAL - CARRY FORWARD TO NEXT PAGE

wo: WO\_580

AIRFRAME - page 1 of 1



Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 9416001791

**N46545**  
Tach: 151.0

**December 23, 2019**

1. PERFORMED AIRFRAME INSPECTION IAW C172 MM.

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: WO\_580.

Stephen LaGrand Airframe & Powerplant 3691597

wo: WO\_599

AIRFRAME - page 1 of 1



Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 9416001791

**N46545**  
Tach: 159.9

**January 2, 2020**

CLEANED CORROSION FROM LIGHT AND MOUNTING. OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: WO\_599.

Gene Antini Airframe & Powerplant I.A. 57503505

wo: WO\_601

AIRFRAME - page 1 of 1



Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 9416001791

**N46545**  
Tach: 159.9

**January 2, 2020**

R/R BROKEN VHF ANTENNA. Installed (1) CI-121 - ANTENNA, VHF, COMM, S/N: 607420. OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: WO\_601.

Gene Antini Airframe & Powerplant I.A. 57503505

**SUB-TOTAL THIS PAGE**

**TOTAL - CARRY FORWARD**

# AIRCRAFT MAINTENANCE RECORD


Page No. \_\_\_\_\_

Date \_\_\_\_\_  
**CARRIED FORWARD** →

Total Time \_\_\_\_\_

DESCRIPTION OF WORK PERFORMED  
SIGNATURE & CERTIFICATE NUMBER OF PERSON PERFORMING WORK


wo: WO\_558 AIRFRAME - page 1 of 1

 **FFM**  
FLORIDA FLIGHT MAINTENANCE  
Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 9416001791


**N46545** **December 16, 2019**  
Tach: 142.9

1. REMOVED AND REPLACE COWLING MOUNT IAW C172 MM Installed (1) J7444-42 - FASTENER, BONDED.

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: WO\_558.

Gene Antini Airframe & Powerplant I.A. 57503505 

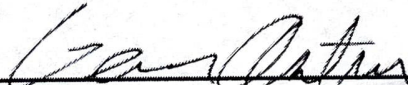
wo: WO\_563 AIRFRAME - page 1 of 1

 **FFM**  
FLORIDA FLIGHT MAINTENANCE  
Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 9416001791

**N46545** **December 17, 2019**  
Tach: 145.3

1. R/R LEFT WING FUEL DRAIN. Installed (1) F-391-72 - FLUSH DRAIN VALVE.  
2. LUBED AND ADJUSTED. ~~PILON AIR VENT.~~

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: WO\_563.

Gene Antini Airframe & Powerplant I.A. 57503505 

wo: WO\_564 AIRFRAME - page 1 of 1

 **FFM**  
FLORIDA FLIGHT MAINTENANCE  
Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285 · 9416001791

**N46545** **December 17, 2019**  
Tach: 145.3

REPAIRED CRACKED ENGINE COWLING. OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: WO\_564.

Gene Antini Airframe & Powerplant I.A. 57503505 

	<b>SUB-TOTAL</b> THIS PAGE
	<b>TOTAL</b> - CARRY FORWARD TO NEXT PAGE


# AIRCRAFT MAINTENANCE RECORD

Page No. \_\_\_\_\_

Date	Total Time	DESCRIPTION OF WORK PERFORMED SIGNATURE & CERTIFICATE NUMBER OF PERSON PERFORMING WORK
------	------------	---

**CARRIED FORWARD** →

wo: WO\_474 Airframe - page 1 of 1

 **FFM**  
FLORIDA FLIGHT MAINTENANCE


Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285

---


**N46545** **November 11, 2019**  
Tach: 70.2

**CESSNA, 172K, S/N: 17257341**

TROUBLESHOOTED RADIO, REPLACED PTT CORD, OPS CHECK GOOD. OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: WO\_474.

Gene Antini Airframe & Powerplant I.A. 57503505 

wo: WO\_502 AIRFRAME - page 1 of 1

 **FFM**  
FLORIDA FLIGHT MAINTENANCE

Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285


---

**N46545** **November 23, 2019**  
Tach: 98.3


1. OPENED PANELS, LUBED AND INSPEXED PER MANUFACTURES CHECKLIST. INSPECTED ELT IAW FAR 92.207(d). CHECKED CABLE TENSIONS, CHECKED AD COMPLIANCE THRU CURRENT ISSUE, COMPLIED WITH AD 72-03-03, REINSTALLED PANELS, I CERTIFY THIS AIRFRAME HAS BEEN INSPECTED IAW AN 100 HOUR INSPECTION AND DETERMINED AIRWORTHY AT THIS TIME.

2. REMOVED AND REPLACED BAGGARGE COMPARTMENT BACK PANEL AND BAGGAGE DOOR PANEL. Installed (1) K0700114-35 - PANEL, BAGGAGE DOOR, Installed (1) K0500210-42 - PANEL, BAGGAGE COMPARTMENT, C-172K.

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: WO\_502.

Stephen LaGrand Airframe & Powerplant 3691597 

wo: WO\_518 AIRFRAME - page 1 of 1


 **FFM**  
FLORIDA FLIGHT MAINTENANCE

Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285

---

**N46545** **November 27, 2019**  
Tach: 111.3

REMOVE RIGHT NAV LIGHT AND CLEANED CORROSION FROM BULB PLUG AND GROUND. OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: WO\_518.

Gene Antini Airframe & Powerplant I.A. 57503505 

# AIRCRAFT MAINTENANCE RECORD

Page No. \_\_\_\_\_

Date	Total Time	DESCRIPTION OF WORK PERFORMED SIGNATURE & CERTIFICATE NUMBER OF PERSON PERFORMING WORK
------	------------	---

**CARRIED FORWARD** →

wo: WO\_450 Airframe - page 1 of 1

 **FFM**  
FLORIDA FLIGHT MAINTENANCE

Florida Flight Maintenance - 160 East Airport Ave - Venice, FL 34285


---

**N46545** **CESSNA, 172K, S/N: 17257341** **November 5, 2019**  
Tach: 55.0

R/R BOTH MM TIRES Installed (2) 6.00 x 6 x 6 Retread - Tire, S/N: 82132218, 82762132. OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: WO\_450.

Gene Antini Airframe & Powerplant I.A. 57503505 

wo: WO\_457 Airframe - page 1 of 1


 **FFM**  
FLORIDA FLIGHT MAINTENANCE

Florida Flight Maintenance - 160 East Airport Ave - Venice, FL 34285


---

**N46545** **CESSNA, 172K, S/N: 17257341** **November 6, 2019**  
Tach: 60.7

INSPECTED INSTALLATION AND FOUND STARTER LOOSE. TIGHTENED BOLTS TO SPEC. OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: WO\_457.

Gene Antini Airframe & Powerplant I.A. 57503505 

wo: WO\_470 Airframe - page 1 of 1

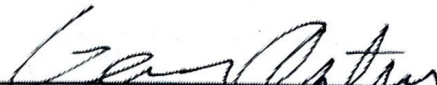
 **FFM**  
FLORIDA FLIGHT MAINTENANCE

Florida Flight Maintenance - 160 East Airport Ave - Venice, FL 34285

---

**N46545** **CESSNA, 172K, S/N: 17257341** **November 8, 2019**  
Tach: 66.4

PILOT PTT SWITCH WIRE FRAYED, GROUNDING AT YOKE ATTACHMENT. ADJUSTED WIRE ATTACHMENT TO INSULATE GROUND. OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: WO\_470.

Gene Antini Airframe & Powerplant I.A. 57503505 


**SUB-TOTAL** THIS PAGE

**TOTAL - CARRY FORWARD** TO NEXT PAGE


# AIRCRAFT MAINTENANCE RECORD

Page No. \_\_\_\_\_

Date	Total Time	DESCRIPTION OF WORK PERFORMED SIGNATURE & CERTIFICATE NUMBER OF PERSON PERFORMING WORK
------	------------	---

**CARRIED FORWARD** →

wo: WO\_430 Airframe - page 1 of 1




## FFM

FLORIDA FLIGHT MAINTENANCE


Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285

**N46545** **CESSNA, 172K, S/N: 17257341** **October 29, 2019**  
 Tach: 51.4

50 HOUR SERVICE. OIL/FILTER CHANGE. BATTERY LEVELS CHECKED, RIGHT BRAKE SERVICED. Installed (1) CH48110-1 - Oil Filter, Installed (1) CamGuard - CamGuard, Installed (7) Aeroshell W100 (quart) - Aeroshell W100 Oil. OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: WO\_430.

Gene Antini Airframe & Powerplant I.A. 57503505 

wo: WO\_435 Airframe - page 1 of 1




## FFM

FLORIDA FLIGHT MAINTENANCE


Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285

**N46545** **CESSNA, 172K, S/N: 17257341** **October 30, 2019**  
 Tach: 51.4

RAN ENGINE PRESSURE FOR TEMP., TEMP CHECK GOOD. COULD NOT DUPLICATE. OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: WO\_435.

Gene Antini Airframe & Powerplant I.A. 57503505 

wo: WO\_448 Airframe - page 1 of 1




## FFM

FLORIDA FLIGHT MAINTENANCE

Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285

**N46545** **CESSNA, 172K, S/N: 17257341** **November 5, 2019**  
 Tach: 55.0

FOUND BROKEN GROUND WIRE ON NAV LIGHT. REPAIRED WIRE CONNECTOR. OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: WO\_448.


Gene Antini Airframe & Powerplant I.A. 57503505 

	<b>SUB-TOTAL</b> THIS PAGE
	<b>TOTAL</b> - CARRY FORWARD TO NEXT PAGE

# AIRCRAFT MAINTENANCE RECORD

Date	Total Time	DESCRIPTION OF WORK PERFORMED SIGNATURE & CERTIFICATE NUMBER OF PERSON PERFORMING WORK
<b>CARRIED FORWARD</b> →		

wo: 2019-854 Airframe - page 1 of 1



## FFM

FLORIDA FLIGHT MAINTENANCE

Florida Flight Maintenance - 160 East Airport Ave - Venice, FL 34285

---

**N46545** **CESSNA, 172K, S/N: 17257341** **September 24, 2019**

Tach: 1687.9

1. R/R TACHOMETER AND BROKEN TACH CABLE. Installed (1) 10-24644 - RECORDING TACHOMETER, MECHANICAL, S/N: 4217.

OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: 2019-854.

Gene Antini Airframe & Powerplant I.A. 57503505 *Gene Antini*

**TACH SCALE CORRECTION CARD**

Instr. P/N: D1-112-5024

Serial No.: 4217

Power Setting                      Indication


500 RPM	<u>410</u>
1000 RPM	<u>1010</u>
1500 RPM	<u>1505</u>
2000 RPM	<u>2005</u>
2500 RPM	<u>2505</u>
3000 RPM	<u>3000</u>
3500 RPM	<u>3500</u>

Inspector AM Date 3-22-19

23/09/19 OLD TACH:1687.9

23/09/19 NEW TACH:0

wo: 2019-896 Airframe - page 1 of 1



## FFM

FLORIDA FLIGHT MAINTENANCE

Florida Flight Maintenance - 160 East Airport Ave - Venice, FL 34285

---

**N46545** **CESSNA, 172K, S/N: 17257341** **October 29, 2019**

Tach: 51.4

REMOVED BAD PTT SWITCH, ALSO SELECT CORRECT POSITION ON AUDIO PANEL. OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: 2019-896.

Gene Antini Airframe & Powerplant I.A. 57503505 *Gene Antini*


**SUB-TOTAL** THIS PAGE

**TOTAL** - CARRY FORWARD TO NEXT PAGE




# AIRCRAFT MAINTENANCE RECORD

Page No. \_\_\_\_\_

Date	Total Time	DESCRIPTION OF WORK PERFORMED SIGNATURE & CERTIFICATE NUMBER OF PERSON PERFORMING WORK
<b>CARRIED FORWARD</b> →		

wo: 2019-859 Airframe - page 1 of 1




**FFM**  
FLORIDA FLIGHT MAINTENANCE

Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285


---

**N46545** **CESSNA, 172K, S/N: 17257341** **September 24, 2019**  
Tach: 1687.9

R/R ELT BATTERY. NEW DUE DATE NOV 2012. OPERATIONAL CHECK GOOD. Installed (1) BP-1010 - ELT Battery. OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: 2019-859.

Gene Antini Airframe & Powerplant I.A. 57503505 

wo: 2019-855 Airframe - page 1 of 1




**FFM**  
FLORIDA FLIGHT MAINTENANCE

Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285

---

**N46545** **CESSNA, 172K, S/N: 17257341** **September 24, 2019**  
Tach: 1687.9

ADJUSTED LOOSE HOLDING SPRING IN RADIO CASE IAW NARCO 12D MANUAL. OPERATIONAL CHECK IS GOOD AND ALL WORK WAS PERFORMED IN ACCORDANCE WITH THE APPLICABLE MAINTENANCE MANUALS. Details of work performed are on file with Florida Flight Maintenance under work order: 2019-855.

Gene Antini Airframe & Powerplant I.A. 57503505 

wo: 2019-854 Airframe - page 1 of 1




**FFM**  
FLORIDA FLIGHT MAINTENANCE

Florida Flight Maintenance · 160 East Airport Ave · Venice, FL 34285

---

**N46545** **CESSNA, 172K, S/N: 17257341** **September 24, 2019**  
Tach: 1687.9

1. R/R VACUUM AND INSTRUMENT AIR FILTERS IAW C172 MM Installed (1) RA-D-9-14-5 - PNEUMATIC FILTERS. ALL WORK PERFORMED IAW THE APPLICABLE MAINTENANCE MANUALS.

Gene Antini Airframe & Powerplant I.A. 57503505 

	<p><b>SUB-TOTAL</b> THIS PAGE</p> <p><b>TOTAL</b> - CARRY FORWARD TO NEXT PAGE</p>

# AIRCRAFT MAINTENANCE RECORD

Page No. \_\_\_\_\_

Date	Total Time	DESCRIPTION OF WORK PERFORMED SIGNATURE & CERTIFICATE NUMBER OF PERSON PERFORMING WORK
<b>CARRIED FORWARD</b> →		

WO: 2019-841

USE ONLY FOR 100 HOUR - page 1 of 1

**TOTAL TIME AF** ~~25576~~  
**AFT.T. 3506.6**



Florida Flight Maintenance - 160 East Airport Ave - Venice, FL 34285

**N46545**  
Tach: 1687.1

**September 21, 2019**

1. Performed a 100 hour inspection of this engine. [LYCOMING O-360-A4A SN: L-10486-36A] Installed new oil filter AA48110-2. Serviced engine with 7 qts Aeroshell W100, and 8 oz Camguard oil additive. Checked cylinder compression with hot engine, and results are listed above installed SERVICEABLE spark plugs, Champion PN- UREM38E. Cleaned gascolator bowl and screen. Ran engine and returned to service. I certify that this engine has been inspected IAW a 100 hour inspection as per, FAR 43 Appendix D and it is determined to be in airworthy condition at this time.
2. PERFORMED A 100 HOUR INSPECTION ON THIS PROPELLER [76EM85-0-60] PERFORMED INSPECTION IAW CHECKLIST AND FAR 43 APPENDIX D ALL SYSTEMS WORKED ON HAVE BEEN OPS CHECKED AND TESTED GOOD IAW APPLICABLE MAINTENANCE MANUALS AND HAS BEEN FOUND TO BE IN AIRWORTHY CONDITION AT THIS TIME.
3. PERFORMED A 100 HOUR INSPECTION ON THIS AIRFRAME. ALL INSPECTIONS WERE DONE IAW THE CHECKLIST AND CESSNA 172 MM. I certify this airframe has been inspected in accordance with 14 CFR, part 43 App. D, 100 hour inspection, and has been found to be in an in airworthy condition at this time.
4. PERFORMED PRE INSPECTION ENGINE RUN UP IAW POH ATTACHED CHECKLIST AND C172 MM.
5. PERFORMED ENGINE INSPECTION CHANGED OIL AND OIL FILTER REMOVED AND REPLACED SPARK PLUGS WITH SERVICEABLE ONES, INSPECTED OIL FILTER FOR DEBRIS. NO DEFECTS NOTED. IAW CHECKLIST AND C172 MM. Installed (1) CamGuard - CamGuard, Installed (7) Aeroshell W100 - Aeroshell W100, Installed (1) AA48110-2 - OIL FILTER.
6. COMPRESSION TEST AS FOLLOWS: #1 - 80/80 #2 - 76/80 #3 - 79/80 #4 - 79/80.
7. PERFORMED PROPELLER INSPECTION IAW CHECKLIST AND C172 MM.
8. PERFORMED FUSELAGE INSPECTION IAW CHECKLIST AND C172 MM.
9. PERFORMED CABIN INSPECTION IAW CHECKLIST AND C172 MM.
10. PERFORMED WING INSPECTION IAW CHECKLIST AND C172 MM.
11. R/R VACUUM AND INSTRUMENT AIR FILTERS IAW C172 MM Installed (1) 10-01333 - AIR FILTER, GARTER.
12. PERFORMING LANDING GEAR INSPECTION IAW CHECKLIST AND C172 MM.
13. PERFORMED EMPENNAGE INSPECTION IAW CHECKLIST AND C172 MM.
14. PERFORMED ELT TEST IAW FAR 91.207 APP D AND ALL APPLICABLE MM.
15. BI-ANNUAL TRANSPONDER AND ALTIMETER INSPECTION LAST COMPLIANCE ACCOMPLISHED 10/12/2018, ELT BATTERY DUE DATE 9/2019.
16. COMPLIED WITH AD INSPECTION THRU CURRENT TDATA. NO AD'S DUE AT THIS TIME.
17. REMOVED AND REPLACED BAFFLE IAW C172 MM.
18. NARCO RADIO REMOVED FOR BENCH TEST. REPAIRED AND REINSTALLED IN AIRCRAFT.

I CERTIFY THAT THIS AIRFRAME, ENGINE AND PROPELLER WERE INSPECTED IN ACCORDANCE WITH OUR 100 HOUR INSPECTION CHECKLIST AS PER FAR 43 APP D. AD's CW through T-DATA 2019-05, NO AD'S DUE AT THIS TIME AND WERE DETERMINED TO BE IN AIRWORTHY CONDITION AT THIS TIME. Details of work performed are on file with Florida Flight Maintenance under work order: 2019-841.

Gene Antini Airframe & Powerplant I.A. 57503505

		<b>SUB-TOTAL THIS PAGE</b>
		<b>TOTAL - CARRY FORWARD TO NEXT PAGE</b>